


These test results apply only to the samples which were tested. the testing report shall not be reproduced, except in full, without the written approval of K & A, Inc

Particle Size Distribution Report

ASTM C136

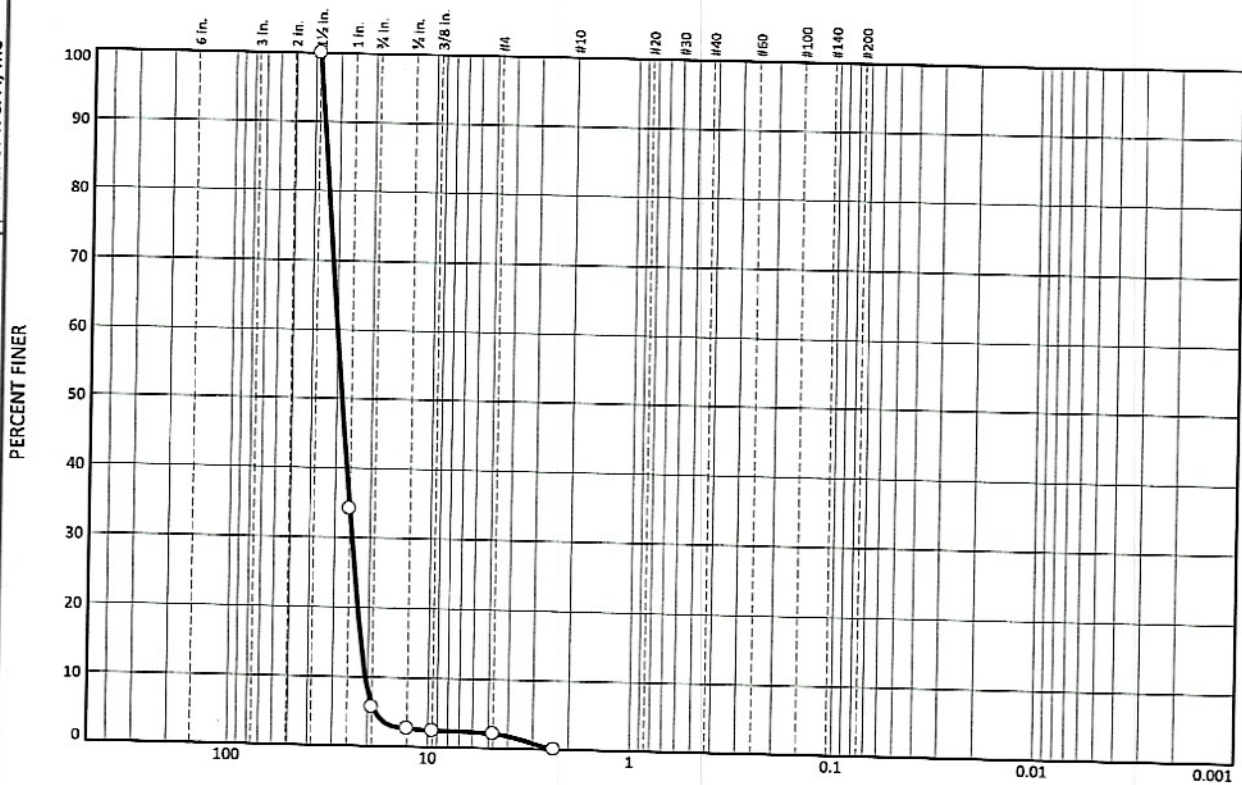

% +3"	% Gravel		% Sand			% Fines	
	Coarse	Fine	Coarse	Medium	Fine	Silt	Clay
0	94	4	2	0	0	0	0

Test Results (ASTM C136)				
Sieve Size or Diam. (mm.)	Finer (%)	Spec. * (%)	Out of Spec. (%)	Pct. of Fines
1-1/2"	100			
1"	34			
3/4"	6			
1/2"	3			
3/8"	2			
#4	2			
#8	0			

* (no specification provided)

Material Description
poorly graded gravel

PL=

Atterberg Limits
LL=

PI=

USCS= GP

Classification
AASHTO=

Test Remarks

Location: DEN North Yard - Quennsburg Pit - 1-1/2"-3/4" Screened Concrete Rock
Sample Number: 5011

Sample Date: 5/29/26

Kumar & Associates, Inc. Denver, Colorado	Client: Colorado Aggregate Recycling Project: Colorado Aggregate Recycling - 2026 Various Laboratory Projects Project No: 26-1-168	Figure
--	---	---------------

Tested By: KDW
Checked By: JJM